

SECTION 1) CHEMICAL PRODUCT AND SUPPLIER'S IDENTIFICATION

Product ID: .47670

Product Name: BLACK TRAFFIC MARKING PAINT

 Revision Date:
 Dec 23, 2016
 Date Printed:
 Dec 23, 2016

 Version:
 2.0
 Supersedes Date:
 Nov 18, 2015

Manufacturer's Name: Repcolite Paints, Inc.

Address: 473 West 17th Street Holland, MI, US, 49423

Emergency Phone: 800-535-5053 **Information Phone Number:** 616-396-1275 **Fax:** 616-396-9654

SECTION 2) HAZARDS IDENTIFICATION

Classification:

Specific Target Organ Toxicity - Repeated Exposure - Category 1

Aspiration Hazard - Category 1

Skin Irritation - Category 3

Skin Sensitizer - Category 1

Germ Cell Mutagenicity - Category 1B

Carcinogenicity - Category 1B

Reproductive Toxicity - Category 2

Eye Irritation - Category 2

Chronic aquatic toxicity - Category 2

Flammable Liquids - Category 1

Pictograms:









Signal Word:

Danger

Hazardous Statements - Physical:

H224 - Extremely flammable liquid and vapor

Hazardous Statements - Health:

H372 - Causes damage to organs through prolonged or repeated exposure.

H304 - May be fatal if swallowed and enters airways

H316 - Causes mild skin irritation

H317 - May cause an allergic skin reaction

H340 - May cause genetic defects.

H350 - May cause cancer

H361 - Suspected of damaging fertility or an unborn child.

H319 - Causes serious eye irritation

Hazardous Statements - Environmental:

H411 - Toxic to aquatic life with long lasting effects

Precautionary Statements - General:

- P101 If medical advice is needed, have product container or label at hand.
- P102 Keep out of reach of children.
- P103 Read label before use.

Precautionary Statements - Prevention:

- P260 Do not breathe dust/fume/gas/mist/vapors/spray.
- P264 Wash thoroughly after handling.
- P270 Do not eat, drink or smoke when using this product.
- P261 Avoid breathing dust/fume/gas/mist/vapors/spray.
- P272 Contaminated work clothing should not be allowed out of the workplace.
- P280 Wear protective gloves/protective clothing/eye protection/face protection.
- P201 Obtain special instructions before use.
- P202 Do not handle until all safety precautions have been read and understood.
- P273 Avoid release to the environment.
- P210 Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking.
- P233 Keep container tightly closed.
- P240 Ground/bond container and receiving equipment.
- P241 Use explosion-proof [electrical/ventilating/lighting/...] equipment.
- P242 Use only non-sparking tools.
- P243 Take action to prevent static discharges.

Precautionary Statements - Response:

- P314 Get Medical advice/attention if you feel unwell.
- P301 + P310 IF SWALLOWED: Immediately call a POISON CENTER or doctor.
- P331 Do NOT induce vomiting.
- P332 + P313 If skin irritation occurs: Get medical advice/attention.
- P302 + P352 IF ON SKIN: Wash with plenty of water.
- P333 + P313 If skin irritation or a rash occurs: Get medical advice/attention.
- P321 For specific treatment see section 4.
- P362 + P364 Take off contaminated clothing. And wash it before reuse.
- P308 + P313 IF exposed or concerned: Get medical advice/attention.
- P305 + P351 + P338 IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing.
- P337 + P313 If eye irritation persists: Get medical advice/attention.
- P391 Collect spillage.
- P303 + P361 + P353 IF ON SKIN (or hair): Take off immediately all contaminated clothing. Rinse skin with water [or shower].
- P370 + P378 In case of fire: Use dry chemical, foam, or carbon dioxide to extinguish.

Precautionary Statements - Storage:

- P405 Store locked up.
- P403 + P235 Store in a well-ventilated place. Keep cool.

Precautionary Statements - Disposal:

P501 - Dispose of contents/container to disposal recycling center. Under RCRA it is the responsibility of the user of the product to determine at the time of disposal whether the product meets RCRA criteria for hazardous waste. Waste management should be in full compliance with federal, state and local laws.

SECTION 3) COMPOSITION / INFORMATION ON INGREDIENTS

CAS	Chemical Name	% By Weight
0037244-96-5	NEPHELINE SYENITE	24% - 39%
0008052-41-3	STODDARD SOLVENT	15% - 25%
0064742-49-0	VM & P NAPHTHA	11% - 25%
0001335-30-4	ALUMINUM SILICATE HYDRATE	0.1% - 1.4%
0000108-38-3	M-XYLENE	0.0% - 0.4%
0000096-29-7	2-BUTANONE OXIME	0.0% - 0.3%
0000136-51-6	CALCIUM 2-ETHYLHEXANOATE	0.0% - 0.3%
0000095-47-6	O-XYLENE	Trace
0000100-41-4	ETHYLBENZENE	Trace
0000106-42-3	P-XYLENE	Trace
	0037244-96-5 0008052-41-3 0064742-49-0 0001335-30-4 0000108-38-3 0000096-29-7 0000136-51-6 0000095-47-6	0037244-96-5 NEPHELINE SYENITE 0008052-41-3 STODDARD SOLVENT 0064742-49-0 VM & P NAPHTHA 0001335-30-4 ALUMINUM SILICATE HYDRATE 0000108-38-3 M-XYLENE 0000096-29-7 2-BUTANONE OXIME 0000136-51-6 CALCIUM 2-ETHYLHEXANOATE 0000095-47-6 O-XYLENE 0000100-41-4 ETHYLBENZENE

Specific chemical identity and/or exact percentage (concentration) of the composition has been withheld to protect confidentiality.

SECTION 4) FIRST-AID MEASURES

Inhalation:

Remove source of exposure or move person to fresh air and keep comfortable for breathing.

If unwell or exposed and concerned: Get medical attention.

Eliminate all ignition sources if safe to do so.

Skin Contact:

If you feel unwell or if concerned: Get medical advice/attention.

Take off all contaminated clothing, shoes, and leather goods (e.g.,watchbands, belts). Wash with plenty of lukewarm, gently flowing water for a duration of 15-20 minutes. If skin irritation or rash occurs: Get medical advice/attention.

Wash contaminated clothing before re-use.

Eye Contact:

Rinse eyes cautiously with lukewarm, gently flowing water for several minutes, while holding the eyelids open. Remove contact lenses, if present and easy to do. Continue rinsing for 15-20 minutes. Take care not to rinse contaminated water into the unaffected eye or onto the face. If eye irritation persists: Get medical advice/attention.

Ingestion:

Immediately call a POISON CENTER/doctor. Do NOT induce vomiting. If vomiting occurs naturally, lie on your side, in the recovery position.

IF exposed or concerned: Get medical advice/attention.

SECTION 5) FIRE-FIGHTING MEASURES

Suitable Extinguishing Media:

Dry chemical, foam, or carbon dioxide is recommended. Water spray is recommended to cool or protect exposed materials or structures. Carbon dioxide can displace oxygen. Use caution when applying carbon dioxide in confined spaces. Simultaneous use of foam and water on the same surface is to be avoided as water destroys the foam.

SMALL FIRE: Use DRY chemical powder.

Unsuitable Extinguishing Media:

No data available.

Specific Hazards in Case of Fire:

Vapors are heavier than air and may travel along the ground to ignition sources at locations distant from material handling point.

Vapor accumulations and spray mist may flash or explode if ignited.

Closed containers may rupture due to pressure buildup when exposed to extreme heat.

Fire-fighting Procedures:

Isolate immediate hazard area and keep unauthorized personnel out. Stop spill/release if it can be done safely. Move undamaged containers from immediate hazard area if it can be done safely. Water spray may be useful in minimizing or dispersing vapors and to protect personnel. Water may be ineffective but can be used to cool containers exposed to heat or flame. Caution should be exercised when using water or foam as frothing may occur, especially if sprayed into containers of hot, burning liquid.

Dispose of fire debris and contaminated extinguishing water in accordance with official regulations.

Special Protective Actions:

Wear protective pressure self-contained breathing apparatus (SCBA) and full turnout gear.

.47670 Page 3 of 9

SECTION 6) ACCIDENTAL RELEASE MEASURES

Emergency Procedure:

ELIMINATE all ignition sources (no smoking, flares, sparks or flames in immediate area).

Do not touch or walk through spilled material.

Isolate hazard area and keep unnecessary people away. Remove all possible sources of ignition in the surrounding area. Notify authorities if any exposure to the general public or the environment occurs or is likely to occur.

If spilled material is cleaned up using a regulated solvent, the resulting waste mixture may be regulated.

Recommended Equipment:

Positive pressure, full-face piece self-contained breathing apparatus SCBA), or positive pressure supplied air respirator with escape SCBA (NIOSH approved).

Personal Precautions:

Avoid breathing vapor. Avoid contact with skin, eye or clothing. Do not touch damaged containers or spilled materials unless wearing appropriate protective clothing

Environmental Precautions:

Stop spill/release if it can be done safely. Prevent spilled material from entering sewers, storm drains, other unauthorized drainage systems and natural waterways by using sand, earth, or other appropriate barriers.

Methods and Materials for Containment and Cleaning up:

Dike area to contain spill.

Absorb spill with a non-flammable absorbent. Place in closeable containers using non-sparking tools.

Wiping rags or other absorbents saturated with this product are potential sources of spontaneous combustion. Store all rags in a closed, water-filled container or spread out and allow to dry completely before disposal.

SECTION 7) HANDLING AND STORAGE

General:

Wash hands after use.

Do not get in eyes, on skin or on clothing.

Do not breathe vapors or mists.

Use good personal hygiene practices.

Eating, drinking and smoking in work areas is prohibited.

Remove contaminated clothing and protective equipment before entering eating areas.

Eyewash stations and showers should be available in areas where this material is used and stored.

Ventilation Requirements:

Use only with adequate ventilation to control air contaminants to their exposure limits. The use of local ventilation is recommended to control emissions near the source.

Storage Room Requirements:

Keep container(s) tightly closed and properly labeled. Store in cool, dry, well-ventilated areas away from heat, direct sunlight, strong oxidizers and any incompatibilities. Store in approved containers and protect against physical damage. Keep containers securely sealed when not in use. Indoor storage should meet OSHA standards and appropriate fire codes. Containers that have been opened must be carefully resealed to prevent leakage. Empty containers retain residue and may be dangerous.

Use non-sparking ventilation systems, approved explosion-proof equipment and intrinsically safe electrical systems in areas where this product is used and stored.

SECTION 8) EXPOSURE CONTROLS, PERSONAL PROTECTION

Eve Protection:

Wear eye protection with side shields or goggles. Wear indirect-vent, impact and splash resistant goggles when working with liquids. If additional protection is needed for entire face, use in combination with a face shield.

Skin Protection:

Use of gloves approved to relevant standards made from the following materials may provide suitable chemical protection: PVC, neoprene or nitrile rubber gloves. Suitability and durability of a glove is dependent on usage, e.g. frequency and duration of contact, chemical resistance of glove material, glove thickness, dexterity. Always seek advice from glove suppliers. Contaminated gloves should be replaced. Use of an apron and over- boots of chemically impervious materials such as neoprene or nitrile rubber is recommended to avoid skin sensitization. The type of protective equipment must be selected according to the concentration and amount of the dangerous substance at the specific workplace. Launder soiled clothes or properly disposed of contaminated material, which cannot be decontaminated.

Respiratory Protection:

If engineering controls do not maintain airborne concentrations to a level which is adequate to protect worker, a respiratory protection program that meets or is equivalent to OSHA 29 CFR 1910.134 and ANSI Z88.2 should be followed. Check with respiratory protective equipment suppliers.

Use self-contained breathing apparatus where vapor concentrations are above TLV limits. Below TLV limits, use a NIOSH approved, canister type vapor respirator.

Appropriate Engineering Controls:

Provide exhaust ventilation or other engineering controls to keep the airborne concentrations of vapors below their respective threshold limit value.

Chemical Name	OSHA TWA (ppm)	OSHA TWA (mg/m3)	OSHA STEL (ppm)	OSHA STEL (mg/m3)	OSHA Tables (Z1, Z2, Z3)	OSHA Carcinogen	OSHA Skin designation	ACGIH TWA (ppm)	ACGIH TWA (mg/m3)	ACGIH STEL (ppm)	ACGIH STEL (mg/m3)	ACGIH Carcinogen
ALUMINUM SILICATE HYDRATE									1 (R)			A4
ETHYLBENZENE	100	435			1			20				A3
M-XYLENE	100	435			1			100	434	150	651	A4
O-XYLENE	100	435			1			100	434	150	651	A4
P-XYLENE	100	435			1			100	434	150	651	A4
STODDARD SOLVENT	500	2900			1			100	572			
VM & P NAPHTHA	500	2000			1							

Chemical Name	ACGIH Notations	ACGIH TLV Basis
ALUMINUM SILICATE HYDRATE	A4	Pneumoco niosis; LRT irr; neurotoxicit y
ETHYLBENZENE	A3; BEI	URT irr;Kidney dam (nephropat hy); Cochlear impair
M-XYLENE	A4; BEI	URT & eye irr; CNS impair
O-XYLENE	A4; BEI	URT & eye irr; CNS impair
P-XYLENE	A4; BEI	URT & eye irr; CNS impair
STODDARD SOLVENT		Eye, skin, & kidney dam; nausea; CNS impair
VM & P NAPHTHA		

A3 - Confirmed Animal Carcinogen with Unknown Relevance to Humans, A4 - Not Classifiable as a Human Carcinogen, BEI - Substances for which there is a Biological Exposure Index or Indices, CNS - Central nervous system, dam - Damage, impair - Impairment, irr - Irritation, LRT - Lower respiratory tract, URT - Upper respiratory tract

The information in this Section does not list components that might have relevant TWA (mg/m3), OSHA Tables (Z1, Z2, Z3), ACGIH TWA (ppm), ACGIH TWA (mg/m3), ACGIH STEL (ppm), ACGIH STEL (mg/m3), ACGIH Carcinoger regulatory values, if they are present at less than 10%. Please contact manufacturer for more information.

SECTION 9) PHYSICAL AND CHEMICAL PROPERTIES

Physical and Chemical Properties

Density 10.03249 lb/gal % Solids By Weight 61.34980%

 Density VOC
 3.87488 lb/gal

 % VOC
 38.62326%

 VOC Actual
 3.87488 lb/gal

 Specific Gravity (g/cm3)
 1.20216

 VOC Regulatory
 3.81560 lb/gal

 VOC Regulatory
 457.22339 g/l

Appearance liquid, mild solvent odor

Odor Threshold N/A N/A Odor Description рΗ N/A Water Solubility Insoluble Flammability N/A Flash Point Symbol N/A N/A Flash Point Viscosity N/A Lower Explosion Level 1 Upper Explosion Level 7 Vapor Pressure N/A

Vapor Density heavier than air

Freezing Point N/A Melting Point N/A Low Boiling Point 334 °F High Boiling Point 334 °F Auto Ignition Temp N/A N/A Decomposition Pt **Evaporation Rate** N/A Coefficient Water/Oil N/A

SECTION 10) STABILITY AND REACTIVITY

Stability:

Stable.

Conditions to Avoid:

Avoid excessive heat, sparks, flame and contact with incompatible materials.

Hazardous Reactions/Polymerization:

No data available.

Incompatible Materials:

Strong oxidizers.

Hazardous Decomposition Products:

May produce fumes when heated to decomposition.

Fumes may contain carbon monoxide and carbon dioxide.

SECTION 11) TOXICOLOGICAL INFORMATION

Skin Corrosion/Irritation:

Prolonged or repeated exposure can cause moderate skin irritation, defatting and dermatitis.

Liquid is irritating to the skin.

Causes mild skin irritation

Serious Eye Damage/Irritation:

Eye contact will result in severe irritation, redness, tearing and blurred vision.

.47670 Page 6 of 9

Causes serious eye irritation

Respiratory/Skin Sensitization:

Excessive inhalation of vapors can cause nasal and respiratory irritation, dizziness, weakness, fatigue, nausea and headache.

Allergic responses may develop.

May cause an allergic skin reaction

Germ Cell Mutagenicity:

May cause genetic defects.

Carcinogenicity:

Risk of lung cancer depends on duration and level of exposure.

May cause cancer

Reproductive Toxicity:

Suspected of damaging fertility or an unborn child.

Specific Target Organ Toxicity - Single Exposure:

No Data Available

Specific Target Organ Toxicity - Repeated Exposure:

May cause potential damage to liver and kidneys through prolonged or repeated exposure.

Reports have associated repeated & prolonged exposure to solvents with permanent brain & nervous system damage.

Causes damage to organs through prolonged or repeated exposure.

Aspiration Hazard:

May be fatal if swallowed and enters airways

Acute Toxicity:

Intentional misuse by deliberately concentrating & inhaling vapors of this product may be harmful or fatal.

If inhaled they can cause headache, breathing difficulties and loss of consciousness.

If ingested, can cause gastrointestinal irritation, nausea, vomiting, and diarrhea.

```
0000095-47-6 O-XYLENE
```

```
LC50 (rat): 5300 ppm (4-hour exposure); cited as 4330 ppm (6-hour exposure) (3)
```

LC50 (mouse): 5630 ppm (4-hour exposure); cited as 4595 ppm (6-hour exposure) (3,4)

LD50 (oral, rat): 3608 mg/kg (3,16)

LD50 (dermal, rabbit): 20000 mg/kg (3)

0000100-41-4 ETHYLBENZENE

LC50 (inhalation, rat): 4000 ppm; 4-hour exposure (3)

LD50 (oral, rat): 3.5 g/kg (1,3,5,10)

LD50 (oral, rat): 4.72 g/kg (3,5,7,8)

LD50 (dermal, rabbit): 17.8 g/kg (11)

0000106-42-3 P-XYLENE

LC50 (rat): 4740 ppm (4-hour exposure) (3)

LC50 (mouse): 4800 ppm (4-hour exposure); cited as 3900 ppm (6-hour exposure) (1,4,6)

LD50 (oral, rat): 4030 mg/kg (3); 4550 mg/kg (10)

0000108-38-3 M-XYLENE

LC50 (rat): 7330 ppm (4-hour exposure); cited as 5984 ppm (6-hour exposure) (3,17)

LC50 (mouse): 6450 ppm (4-hour exposure); cited as 5267 ppm (6-hour exposure) (3)

LD50 (oral, rat): 5011 mg/kg (3); 6660 mg/kg (3)

LD50 (dermal, rabbit): 12180 mg/kg (3,17)

0008052-41-3 STODDARD SOLVENT

LC50 (rat): greater than 5500 mg/m3 (880 ppm) (whole body exposure for 4 hours) (1)

LC50 (rat): greater than 8200 mg/m3 (1300 ppm) (2)

LD50 (oral, rat): greater than 5 g/kg (1)

LD50 (dermal, rabbit): greater than 3 g/kg (1)

Chronic Exposure

0000100-41-4 ETHYLBENZENE

CARCINOGENIC EFFECTS: Ethyl Benzene has been listed by IARC as Group 2B, Possibly Carcinogenic to Humans.

TERATOGENIC EFFECTS: Ethyl Benzene has been Classified as POSSIBLE for humans.

Potential Health Effects - Miscellaneous

Is an IARC, NTP or OSHA carcinogen. Increased susceptibility to the effects of this material may be observed in people with preexisting disease of any of the following: central nervous system, kidneys, liver, lungs. Recurrent overexposure may result in liver and kidney injury. Studies in laboratory animals have shown reproductive, embryotoxic and developmental effects. WARNING: This chemical is known to the State of California to cause cancer.

SECTION 12) ECOLOGICAL INFORMATION

Toxicity:

No data available.

Toxic to aquatic life with long lasting effects

Persistence and Degradability:

No data available.

Bio-accumulative Potential:

No data available.

Mobility in Soil:

No data available.

Other adverse effects:

No data available.

SECTION 13) DISPOSAL CONSIDERATIONS

Waste Disposal:

Under RCRA it is the responsibility of the user of the product to determine at the time of disposal whether the product meets RCRA criteria for hazardous waste. Waste management should be in full compliance with federal, state and local laws.

Empty Containers retain product residue which may exhibit hazards of material, therefore do not pressurize, cut, glaze, weld or use for any other purposes. Return drums to reclamation centers for proper cleaning and reuse.

SECTION 14) TRANSPORT INFORMATION

U.S. DOT Information:

Proper Shipping Name: PAINT Identification Number: UN/NA 1263

Hazard Class:3 Packing group: II

IMDG Information:

Proper Shipping Name: PAINT Identification Number: UN/NA 1263

Hazard Class:3 Packing group: II

Marine Pollutant : No data available

IATA Information:

Proper Shipping Name: PAINT Identification Number: UN/NA 1263

Hazard Class:3 Packing group: II

SECTION 15) REGULATORY INFORMATION

CAS	Chemical Name	% By Weight	Regulation List
0037244-96-5	NEPHELINE SYENITE	24% - 39%	DSL,SARA312
0008052-41-3	STODDARD SOLVENT	15% - 25%	Canada_NPRI,DSL,SARA312,VOC,TSCA
0064742-49-0	VM & P NAPHTHA	11% - 25%	DSL,SARA312,VOC,TSCA
0001335-30-4	ALUMINUM SILICATE HYDRATE	0.1% - 1.4%	DSL,SARA312,TSCA


0000108-38-3	M-XYLENE	0.0% - 0.4%	SARA313, Canada_NPRI,DSL,HAPS,SARA312,VHAPS,VOC,TSCA
0000096-29-7	2-BUTANONE OXIME	0.0% - 0.3%	DSL,SARA312,VOC,TSCA
0000136-51-6	CALCIUM 2- ETHYLHEXANOATE	0.0% - 0.3%	DSL,SARA312,TSCA
0000095-47-6	O-XYLENE	Trace	SARA313, Canada_NPRI,DSL,HAPS,SARA312,VHAPS,VOC,TSCA
0000100-41-4	ETHYLBENZENE	Trace	SARA313, Canada_NPRI,DSL,HAPS,SARA312,VHAPS,VOC,TSCA,CA_Carcinogen,CA_Prop65_Type_Toxicity_Cancer - CA_Proposition65_Type_Toxicity_Cancer
0000106-42-3	P-XYLENE	Trace	SARA313, Canada_NPRI,DSL,HAPS,SARA312,VHAPS,VOC,TSCA

The information in this Section does not list components that might have relevant CA_Carcinogen, CA_Prop65_Type_Toxicity_Cancer - CA_Proposition65_Type_Toxicity_Cancer, Canada_NPRI, DSL, HAPS, SARA312, SARA313, TSCA, VOC regulatory values, if they are present at less than 10%. Please contact manufacturer for more information.

SECTION 16) OTHER INFORMATION

General:

ACGIH- American Conference of Governmental Industrial Hygienists; ANSI- American National Standards Institute; Canadian TDG-Canadian Transportation of Dangerous Goods; CAS- Chemical Abstract Service; Chemtrec- Chemical Transportation Emergency Center (US); CHIP- Chemical Hazard Information and Packaging; DSL- Domestic Substances List; EC- Equivalent Concentration; EH40 (UK)-HSE Guidance Note EH40 Occupational Exposure Limits; EPCRA- Emergency Planning and Community Right-To-Know Act; ESL- Effects screening levels; HMIS- Hazardous Material Information Service; LC- Lethal Concentration; LD- Lethal Dose; NFPA- National Fire Protection Association; OEL- Occupational Exposure Limits; OSHA- Occupational Safety and Health Administration, US Department of Labor; PEL- Permissible Exposure Limit; SARA (Title III)- Superfund Amendments and Reauthorization Act; SARA 313- Superfund Amendments and Reauthorization Act, Section 313; SCBA- Self-Contained Breathing Apparatus; STEL- Short Term Exposure Limit; TCEQ - Texas Commission on Environmental Quality; TLV- Threshold Limit Value; TSCA- Toxic Substances Control Act Public Law 94-469; TWA - Time Weighted Value; US DOT- US Department of Transportation; WHMIS- Workplace Hazardous Materials Information System.

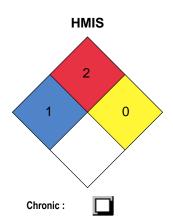

Version 2.0:

Revision Date: Dec 23, 2016

DISCLAIMER

To the best of our knowledge, the information contained herein is accurate. However, neither the above named supplier nor any of its subsidiaries assumes any liability whatsoever for the accuracy or completeness of the information contained herein. Final determination of suitability of any material is the sole responsibility of the user. All materials may present unknown hazards and should be used with caution. Although certain hazards are described herein, we cannot guarantee that these are the only hazards that exist. The above information pertains to this product as currently formulated, and is based on the information available at this time. Addition of reducers or other additives to this product may substantially alter the composition and hazards of the product. Since conditions of use are outside our control, we make no warranties, express or implied, and assume no liability in connection with any use of this information.

.47670 Page 9 of 9