

SAFETY DATA SHEET

SECTION 1) CHEMICAL PRODUCT AND SUPPLIER'S IDENTIFICATION

Product ID:	MIRA 730S							
Product Name:	MIRAVAR PRO CV CLEAR - SEALER	MIRAVAR PRO CV CLEAR - SEALER						
Revision Date:	Jun 04, 2015	Date Printed:	Sep 03, 2015					
Version:	1.0	Supersedes Date:						
Manufacturer's Name:	Mira							
Address:	473 West 17th Street, Holland, MI 494	473 West 17th Street, Holland, MI 49423						
Emergency Phone:	800-535-5053	800-535-5053						
Information Phone:	616-396-1275							
Fax:	616-396-9654							

SECTION 2) HAZARDS IDENTIFICATION

Classification:

Specific Target Organ Toxicity - Single Exposure - Category 1 Specific Target Organ Toxicity - Repeated Exposure - Category 2 Aspiration Hazard - Category 1 Skin Irritation - Category 2 Eye Irritation - Category 2A Germ Cell Mutagenicity - Category 1B Carcinogenicity - Category 1B Reproductive Toxicity - Category 1B Flammable Liquids Category 1 Chronic aquatic toxicity - Category 3 Acute aquatic toxicity - Category 2 Acute toxicity, Dermal - Category 3 Acute toxicity, Inhalation - Category 3 Acute toxicity, Oral - Category 4

Pictograms:



Signal Word:

Danger

Hazardous Statements - Physical:

H224 - Extremely flammable liquid and vapor

Hazardous Statements - Health:

H370 - Causes damage to organs

H373 - May cause damage to organs through prolonged or repeated exposure.

H304 - May be fatal if swallowed and enters airways

H315 - Causes skin irritation

- H319 Causes serious eye irritation
- H340 May cause genetic defects.
- H350 May cause cancer
- H360 May damage fertility or an unborn child
- H302 Harmful if swallowed
- H311 Toxic in contact with skin
- H331 Toxic if inhaled

Hazardous Statements - Environmental:

- H401 Toxic to aquatic life
- H412 Harmful to aquatic life with long lasting effects

Precautionary Statements - General:

- P101 If medical advice is needed, have product container or label at hand.
- P102 Keep out of reach of children.
- P103 Read label before use.

Precautionary Statements - Prevention:

- P260 Do not breathe dust/fume/gas/mist/vapors/spray.
- P264 Wash thoroughly after handling.
- P270 Do not eat, drink or smoke when using this product.
- P280 Wear protective gloves/protective clothing/eye protection/face protection.
- P201 Obtain special instructions before use.
- P202 Do not handle until all safety precautions have been read and understood.
- P273 Avoid release to the environment.
- P210 Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking.
- P233 Keep container tightly closed.
- P240 Ground/bond container and receiving equipment.
- P241 Use explosion-proof [electrical/ventilating/lighting/...] equipment.
- P242 Use only non-sparking tools.
- P243 Take action to prevent static discharges.
- P261 Avoid breathing dust/fume/gas/mist/vapors/spray.
- P271 Use only outdoors or in a well-ventilated area.

Precautionary Statements - Response:

- P308 + P311 IF exposed or concerned: Call a POISON CENTER/doctor.
- P321 For specific treatment see section 4.
- P314 Get Medical advice/attention if you feel unwell.
- P301 + P310 IF SWALLOWED: Immediately call a POISON CENTER or doctor.
- P331 Do NOT induce vomiting.
- P302 + P352 IF ON SKIN: Wash with plenty of water.
- P332 + P313 If skin irritation occurs: Get medical advice/attention.
- P362 + P364 Take off contaminated clothing. And wash it before reuse.

P305 + P351 + P338 - IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing.

- P337 + P313 If eye irritation persists: Get medical advice/attention.
- P308 + P313 IF exposed or concerned: Get medical advice/attention.
- P303 + P361 + P353 IF ON SKIN (or hair): Take off immediately all contaminated clothing. Rinse skin with water [or shower].
- P370 + P378 In case of fire: Use dry chemical, foam, or carbon dioxide to extinguish.
- P301 + P312 IF SWALLOWED: Call a POISON CENTER/doctor if you feel unwell.

P330 - Rinse mouth.

P312 - Call a POISON CENTER/doctor if you feel unwell.

P361 + P364 - Take off immediately all contaminated clothing. And wash it before reuse.

P304 + P340 - IF INHALED: Remove person to fresh air and keep comfortable for breathing. P311 - Call a POISON CENTER/doctor.

Precautionary Statements - Storage:

P405 - Store locked up.

P403 + P235 - Store in a well-ventilated place. Keep cool.

P403 + P233 - Store in a well-ventilated place. Keep container tightly closed.

Precautionary Statements - Disposal:

P501 - Dispose of contents/container to disposal recycling center. Under RCRA it is the responsibility of the user of the product to determine at the time of disposal whether the product meets RCRA criteria for hazardous waste. Waste management should be in full compliance with federal, state and local laws.

Acute toxicity of 31.1% of the mixture is unknown

SECTION 3) COMPOSITION / INFORMATION ON INGREDIENTS

CAS	Chemical Name	% By Weight
0014808-60-7	SILICA, CRYSTALLINE	18% - 30%
proprietary	alkyd resin	11% - 26%
0001330-20-7	XYLENE	6% - 14%
0064742-49-0	VM & P NAPHTHA	6% - 13%
0000067-56-1	METHANOL	6% - 13%
0000108-88-3	TOLUENE	6% - 13%
NA-Repcolite	UREA-FORMALDEHYDE RESIN	5% - 13%
NA-Repcolite	MELAMINE RESIN	2% - 6%
0000100-41-4	ETHYLBENZENE	1.4% - 3%
0068611-44-9	SILICON DIOXIDE (AMORPHOUS)	0.2% - 4%
0000085-68-7	BUTYL BENZYL PHTHALATE	0.1% - 0.9%
0001317-65-3	CALCIUM CARBONATE	0.0% - 0.6%
0000071-36-3	N-BUTYL ALCOHOL	0.0% - 0.3%
0008052-41-3	STODDARD SOLVENT	Trace
0000050-00-0	FORMALDEHYDE	Trace
0000108-65-6	PROPYLENE GLYCOL MONOMETHYL ETHER ACETATE	Trace

SECTION 4) FIRST-AID MEASURES

Inhalation:

Remove source of exposure or move person to fresh air and keep comfortable for breathing.

If exposed or unwell : Call a POISON CENTER/doctor

Skin Contact:

Take off immediately contaminated clothing. Rinse skin with water/shower and mild soap for 5 minutes or until product is removed. Store contaminated clothing under water and wash before re-use or discard.

Eye Contact:

Rinse eyes cautiously with lukewarm, gently flowing water for several minutes, while holding the eyelids open. Remove contact lenses, if present and easy to do. Continue rinsing for 15-20 minutes. Take care not to rinse contaminated water into the unaffected eye or onto the face. If eye irritation persists: Get medical advice/attention.

Ingestion:

Rinse mouth. If you feel unwell or are concerned : Get medical advice/attention.

SECTION 5) FIRE-FIGHTING MEASURES

Suitable Extinguishing Media:

Dry chemical, foam, or carbon dioxide is recommended. Water spray is recommended to cool or protect exposed materials or structures. Carbon dioxide can displace oxygen. Use caution when applying carbon dioxide in confined spaces. Simultaneous use of foam and water on the same surface is to be avoided as water destroys the foam.

Unsuitable Extinguishing Media:

No data available.

Specific Hazards in Case of Fire:

Vapors are heavier than air and may travel along the ground to ignition sources at locations distant from material handling point.

Vapor accumulations and spray mist may flash or explode if ignited.

Closed containers may rupture due to pressure buildup when exposed to extreme heat.

Dried solids can burn.

Fire-fighting Procedures:

Isolate immediate hazard area and keep unauthorized personnel out. Stop spill/release if it can be done safely. Move undamaged containers from immediate hazard area if it can be done safely. Water spray may be useful in minimizing or dispersing vapors and to protect personnel. Water may be ineffective but can be used to cool containers exposed to heat or flame. Caution should be exercised when using water or foam as frothing may occur, especially if sprayed into containers of hot, burning liquid.

Dispose of fire debris and contaminated extinguishing water in accordance with official regulations.

Special Protective Actions:

Wear protective pressure self-contained breathing apparatus (SCBA) and full turnout gear.

SECTION 6) ACCIDENTAL RELEASE MEASURES

Emergency Procedure:

ELIMINATE all ignition sources (no smoking, flares, sparks or flames in immediate area).

Do not touch or walk through spilled material.

Isolate hazard area and keep unnecessary people away. Remove all possible sources of ignition in the surrounding area. Notify authorities if any exposure to the general public or the environment occurs or is likely to occur.

If spilled material is cleaned up using a regulated solvent, the resulting waste mixture may be regulated.

Recommended Equipment:

Positive pressure, full-face piece self-contained breathing apparatus SCBA), or positive pressure supplied air respirator with escape SCBA (NIOSH approved).

Personal Precautions:

Avoid breathing vapor. Avoid contact with skin, eye or clothing. Do not touch damaged containers or spilled materials unless wearing appropriate protective clothing.

Environmental Precautions:

Stop spill/release if it can be done safely. Prevent spilled material from entering sewers, storm drains, other unauthorized drainage systems and natural waterways by using sand, earth, or other appropriate barriers.

Methods and Materials for Containment and Cleaning up:

Absorb spill with inert absorbent.

Dike area to contain spill.

SECTION 7) HANDLING AND STORAGE

General:

Wash hands after use. Do not get in eyes, on skin or on clothing. Do not breathe vapors or mists. Use good personal hygiene practices. Eating, drinking and smoking in work areas is prohibited. Remove contaminated clothing and protective equipment before entering eating areas.

Eyewash stations and showers should be available in areas where this material is used and stored.

Ventilation Requirements:

Use only with adequate ventilation to control air contaminants to their exposure limits. The use of local ventilation is recommended to control emissions near the source.

Storage Room Requirements:

Keep container(s) tightly closed and properly labeled. Store in cool, dry, well-ventilated areas away from heat, direct sunlight, strong oxidizers and any incompatibilities. Store in approved containers and protect against physical damage. Keep containers securely sealed when not in use. Indoor storage should meet OSHA standards and appropriate fire codes. Containers that have been opened must be carefully resealed to prevent leakage. Empty containers retain residue and may be dangerous. Use non-sparking ventilation systems, approved explosion-proof equipment and intrinsically safe electrical systems in areas where this

product is used and stored. Ground and bond containers and receiving equipment. Avoid static electricity by grounding.

SECTION 8) EXPOSURE CONTROLS, PERSONAL PROTECTION

Eye Protection:

Wear eye protection with side shields or goggles. Wear indirect-vent, impact and splash resistant goggles when working with liquids. If additional protection is needed for entire face, use in combination with a face shield.

Skin Protection:

Use of gloves approved to relevant standards made from the following materials may provide suitable chemical protection: PVC, neoprene or nitrile rubber gloves. Suitability and durability of a glove is dependent on usage, e.g. frequency and duration of contact, chemical resistance of glove material, glove thickness, dexterity. Always seek advice from glove suppliers. Contaminated gloves should be replaced. Use of an apron and over- boots of chemically impervious materials such as neoprene or nitrile rubber is recommended to avoid skin sensitization. The type of protective equipment must be selected according to the concentration and amount of the dangerous substance at the specific workplace. Launder soiled clothes or properly disposed of contaminated material, which cannot be decontaminated.

Respiratory Protection:

If engineering controls do not maintain airborne concentrations to a level which is adequate to protect worker, a respiratory protection program that meets or is equivalent to OSHA 29 CFR 1910.134 and ANSI Z88.2 should be followed. Check with respiratory protective equipment suppliers.

Appropriate Engineering Controls:

Provide exhaust ventilation or other engineering controls to keep the airborne concentrations of vapors below their respective threshold limit value.

A suitable, NIOSH-approved respirator and goggles should be worn when standing or grinding objects coated with this paint.

Chemical Name	OSHA TWA (ppm)	OSHA TWA (mg/m3)	OSHA STEL (ppm)	OSHA STEL (mg/m3)	OSHA Tables (Z1, Z2, Z3)	OSHA Carcinogen	OSHA Skin designation	NIOSH TWA (ppm)	NIOSH TWA (mg/m3)	NIOSH STEL (ppm)	NIOSH STEL (mg/m3)	NIOSH Carcinogen
CALCIUM CARBONATE		[15]; [5 (a)];			1				10,5a			
ETHYLBENZENE	100	435			1			100	435	125	545	
FORMALDEHYDE	0.75 (a)		2 / 15minutes		1,2	1		0.016b				1
METHANOL	200	260			1			200	260	250	325	
N-BUTYL ALCOHOL	100	300			1							
SILICA, CRYSTALLINE	а	[10 mg/m3 percent SiO2+2 / 250 percent SiO2+5 mppcf]; [30 mg/m3 percent SiO2+2];			[1,3]; [3];				0.05e			1
STODDARD SOLVENT	500	2900			1				350			
TOLUENE	200 (a)/ 300 ceiling	0.2	500ppm /10 minutes (a)		1,2			100	375	150	560	
VM & P NAPHTHA	500	2000			1				350			
XYLENE	100	435			1			100	435	150	655	

Chemical Name	ACGIH TWA (ppm)	ACGIH TWA (mg/m3)	ACGIH STEL (ppm)	ACGIH STEL (mg/m3)	ACGIH Carcinogen	ACGIH Notations	ACGIH TLV Basis
CALCIUM CARBONATE							

ETHYLBENZENE	20				A3	A3; BEI	URT irr;Kidney dam (nephropat hy); Cochlear impair
FORMALDEHYDE			C 0.3		A2	SEN; A2	URT & eye irr
METHANOL	200	262	250	328		Skin; BEI	Headache, eye dam
N-BUTYL ALCOHOL	20						Eye & URT irr
SILICA, CRYSTALLINE		0.025 (R)			A2	A2	Pulmonary fibrosis; lung cancer
STODDARD SOLVENT	100	572					Eye, skin, & kidney dam; nausea; CNS impair
TOLUENE	20	0.2			A4	A4; BEI	Visual impair; female repro; pregnancy loss
VM & P NAPHTHA							
XYLENE	100	434	150	651	A4	A4; BEI	URT & eye irr; CNS imapir

SECTION 9) PHYSICAL AND CHEMICAL PROPERTIES

Physical and Chemical Properties

Density	9.55802 lb/gal
% Solids By Weight	44.70040%
Density VOC	2.97847 lb/gal
% VOC	31.16206%
VOC Actual	2.97847 lb/gal
Specific Gravity	1.14530
Appearance	N/A
Odor Threshold	N/A
Odor Description	N/A
рН	N/A
Water Solubility	N/A
Flammability	N/A
Flash Point Symbol	N/A
Flash Point	N/A
Viscosity	N/A
Lower Explosion Level	N/A
Upper Explosion Level	N/A
Vapor Pressure	N/A
Vapor Density	N/A
Freezing Point	N/A
Melting Point	N/A
Low Boiling Point	N/A
High Boiling Point	N/A

Auto Ignition Temp	N/A
Decomposition Pt	N/A
Evaporation Rate	N/A
Coefficient Water/Oil	N/A

SECTION 10) STABILITY AND REACTIVITY

Stability:

Stable.

Conditions to Avoid:

Excessive heat.

Hazardous Reactions/Polymerization:

No data available.

Incompatible Materials:

Strong oxidizers.

Hazardous Decomposition Products:

May produce fumes when heated to decomposition.

Fumes may contain carbon monoxide and carbon dioxide.

SECTION 11) TOXICOLOGICAL INFORMATION

Specific Target Organ Toxicity - Repeated Exposure:

May cause damage to organs through prolonged or repeated exposure.

Specific Target Organ Toxicity - Single Exposure:

Causes damage to organs

Acute Toxicity:

No Data Available

Skin Corrosion/Irritation:

Causes skin irritation

Serious Eye Damage/Irritation:

Causes serious eye irritation

Respiratory/Skin Sensitization:

No Data Available

Germ Cell Mutagenicity:

May cause genetic defects.

Carcinogenicity:

May cause cancer

Reproductive Toxicity:

May damage fertility or an unborn child

Aspiration Hazard:

May be fatal if swallowed and enters airways

0001317-65-3 CALCIUM CARBONATE

LD50 (oral, rat): 6450 mg/kg (10; unconfirmed)

0000100-41-4 ETHYLBENZENE

LC50 (inhalation, rat): 4000 ppm; 4-hour exposure (3)

LD50 (oral, rat): 3.5 g/kg (1,3,5,10) LD50 (oral, rat): 4.72 g/kg (3,5,7,8) LD50 (dermal, rabbit): 17.8 g/kg (11) 0000050-00-0 FORMALDEHYDE

LC50 (rat): 8000 ppm (4-hour exposure) (24)

LD50 (oral, male rat): 2500 mg/kg (25)

LD50 (oral, rat): 2920 mg/kg (26)

LD50 (dermal, guinea pig): greater than 15000 mg/kg (cited as greater than 0.94 mL/kg) (27)

LD50 (dermal, rat): 5070 mg/kg (28, unconfirmed)

0000067-56-1 METHANOL

LC50 (rat): 64000 ppm (4-hour exposure) (14, unconfirmed)

LD50 (oral, rat): 5628 mg/kg (14, unconfirmed)

LD50 (oral, 14-day old rat): 5850 mg/kg (cited as 7.4 mL/kg) (15)

LD50 (oral, young adult rat): 10280 mg/kg (cited as 13.0 mL/kg) (15)

LD50 (oral, monkey): 3000 mg/kg (1/1 animal died) (16) LD50 (dermal, rabbit): 15800 mg/kg (cited as 20 mL/kg) (17 citing unpublished information)

0000071-36-3 N-BUTYL ALCOHOL

LC50 (rat): greater than 8000 ppm (4-hour exposure) (14)

LD50 (oral, rat): 2510 mg/kg (15)

LD50 (oral, male rat): 790 mg/kg (16)*

LD50 (oral, female rat): 2020 mg/kg (16)* *(Note: the rats used in this study appear to have been very young (60-100 grams).) LD50 (oral, hamster): 1200 mg/kg (11, original

0008052-41-3 STODDARD SOLVENT

LC50 (rat): greater than 5500 mg/m3 (880 ppm) (whole body exposure for 4 hours) (1)

LC50 (rat): greater than 8200 mg/m3 (1300 ppm) (2)

LD50 (oral, rat): greater than 5 g/kg (1)

LD50 (dermal, rabbit): greater than 3 g/kg (1)

0000108-88-3 TOLUENE

LC50 (rat): 8800 ppm (4-hour exposure) (2)

LC50 (rat): 6000 ppm (6-hour exposure) (3)

LD50 (oral, rat): 2600 to 7500 mg/kg (3,5,11,17)

LD50 (oral, neonatal rat): less than 870 mg/kg (3)

LD50 (dermal, rabbit): 12,225 mg/kg (reported as 14.1 ml/kg) (1)

0001330-20-7 XYLENE

LC50 (rat): 6350 ppm (4-hour exposure) (unspecified isomers and ethylbenzene) (1)LC50 (rat): 6700 ppm (4-hour exposure) (65% m -xylene, 7.6% o-xylene, 7.8% p-xylene, 19.3% ethylbenzene) (2) ethylbenzene) (1)

LC50 (rat): 6700 ppm (4-hour exposure) (65% m-xylene, 7.6% o-xylene, 7.8% p-xylene, 19.3% ethylbenzene)(2)

LD50 (oral, rat): 5400 mg/kg (52% m-, 19% o-, 24% p-) (1)LD50 (oral, female mouse): 5251 mg/kg (60.2% m-, 9.1% o-, 14.6% p-, 17.0% ethylbenzene) (4)

LD50 (oral, male mouse): 5627 mg/kg (60.2% m-, 9.1% o-, 14.6% p-, 17.0% ethylbenzene) (4)

LD50 (dermal, rabbit): 12180 mg/kg (m-xylene); greater than 1700 mg/kg (mixed xylenes - undefined composition) (3)

LD50 (oral, female mouse): 5251 mg/kg (60.2% m-, 9.1% o-, 14.6% p-, 17.0% ethylbenzene) (4)

LD50 (oral, male mouse): 5627 mg/kg (60.2% m-, 9.1% o-, 14.6% p-, 17.0% ethylbenzene) (4)

LD50 (dermal, rabbit): 12180 mg/kg (m-xylene); greater than 1700 mg/kg (mixed xylenes - undefined composition) (3)

Chronic Exposure

0000050-00-0 FORMALDEHYDE

Formaldehyde is classified as a Suspected Human Carcinogen (A2) by ACGIH, and as Probably Carcinogenic to Humans (Group 2A) by IARC. Formaldehyde has caused cancer in test animals.

Formaldehyde has caused cancer in test animals at high concentrations (5-15ppm).

0000100-41-4 ETHYLBENZENE

CARCINOGENIC EFFECTS: Ethyl Benzene has been listed by IARC as Group 2B, Possibly Carcinogenic to Humans.

TERATOGENIC EFFECTS: Ethyl Benzene has been Classified as POSSIBLE for humans.

0000108-88-3 TOLUENE

TERATOGENIC EFFECTS: Toluene has been Classified as POSSIBLE for humans.

0001330-20-7 XYLENE

Xylene in high concentrations has caused embryotoxic effects in laboratory animals.

High exposure to Xylenes in some animal studies have been reported to cause health effects on the developing embryo/fetus.

0014808-60-7 SILICA, CRYSTALLINE

Prolonged inhalation of respirable crystalline silica dust can result in lung disease (i.e. silicosis and/or lung cancer). Symptoms include coughing, shortness of breath, wheezing and reduced pulmonary function.

Potential Health Effects - Miscellaneous

0000067-56-1 METHANOL

Increased susceptibility to the effects of this material may be observed in people with preexisting disease of any of the following: eyes, kidneys, liver, skin. Excessive human exposure to methanol may lead to: fatigue, headache, anaesthetic, neurologic effects, and visual difficulties including blindness or death. Recurrent overexposure may result in liver and kidney injury. Has been toxic to the fetus in laboratory animals at doses that are toxic to the mother. Ingestion may cause any of the following: blindness. Eye contact may cause any of the following: conjunctivitis, mild irritation, corneal opacity.

0000071-36-3 N-BUTYL ALCOHOL

May cause abnormal blood forming function with anemia. Liquid splashes in the eye may result in chemical burns.

0000085-68-7 BUTYL BENZYL PHTHALATE

WARNING: This chemical is known to the State of California to cause birth defects or other reproductive harm.

0000100-41-4 ETHYLBENZENE

Is an IARC, NTP or OSHA carcinogen. Increased susceptibility to the effects of this material may be observed in people with preexisting disease of any of the following: central nervous system, kidneys, liver, lungs. Recurrent overexposure may result in liver and kidney injury. Studies in laboratory animals have shown reproductive, embryotoxic and developmental effects. WARNING: This chemical is known to the State of California to cause cancer.

0000108-65-6 PROPYLENE GLYCOL MONOMETHYL ETHER ACETATE

Recurrent overexposure may result in liver and kidney injury.

0000108-88-3 TOLUENE

Increased susceptibility to the effects of this material may be observed in people with preexisting disease of any of the following: central nervous system, kidneys, liver, respiratory system, skin. Can be absorbed through the skin in harmful amounts. Recurrent overexposure may result in liver and kidney injury. High airborne levels have produced irregular heart beats in animals and occasional palpitations in humans. Rats exposed to very high airborne levels have exhibited high frequency hearing deficits. The significance of this to man is unknown. WARNING: This chemical is known to the State of California to cause birth defects or other reproductive harm.

0001330-20-7 XYLENE

Increased susceptibility to the effects of this material may be observed in people with preexisting disease of any of the following: bone marrow, cardiovascular system, central nervous system, kidneys, liver, lungs. Recurrent overexposure may result in liver and kidney injury. High exposures may produce irregular heart beats. Canada classifies Xylene as a developmental toxin as high exposures to xylenes in some animal studies have been reported to cause health effects on the developing fetus/embryo. These effects were often at levels toxic to the adult animal. The significance of these effects to humans is not known. Repeated or prolonged skin contact may cause any of the following: irritation, dryness, cracking of the skin.

0014808-60-7 SILICA, CRYSTALLINE

Is an IARC, NTP or OSHA carcinogen. Repeated overexposure to crystalline silica may lead to x-ray changes and chronic lung disease. Inhalation of high dust concentrations may cause: breathing difficulties, lung injury. WARNING: This chemical is known to the State of California to cause cancer.

SECTION 12) ECOLOGICAL INFORMATION

Persistence and Degradability:

No data available.

Bio-accumulative Potential:

No data available.

Mobility in Soil:

No data available.

Toxicity:

Toxic to aquatic life

Harmful to aquatic life with long lasting effects

Other adverse effects:

No data available.

Mobility in Soil

0000067-56-1 METHANOL

Will not adsorb on soil.

Persistence and Degradability

0000067-56-1 METHANOL

72% aerobic biodegradability.

SECTION 13) DISPOSAL CONSIDERATIONS

Waste Disposal:

Under RCRA it is the responsibility of the user of the product to determine at the time of disposal whether the product meets RCRA criteria for hazardous waste. Waste management should be in full compliance with federal, state and local laws.

Empty Containers retain product residue which may exhibit hazards of material, therefore do not pressurize, cut, glaze, weld or use for any other purposes. Return drums to reclamation centers for proper cleaning and reuse.

SECTION 14) TRANSPORT INFORMATION

U.S. DOT Information:

Proper Shipping Name: PAINT Identification Number : UN/NA 1263 Hazard Class:3 Packing group: II

IMDG Information:

No data available.


IATA Information:

No data available.

SECTION 15) REGULATORY INFORMATION

CAS	Chemical Name	% By Weight	Regulation List
0014808-60-7	SILICA, CRYSTALLINE	18% - 30%	DSL,SARA312,CA_Carcinogen
proprietary	alkyd resin	11% - 26%	SARA312
0001330-20-7	XYLENE	6% - 14%	Canada_NPRI,DSL,HAPS,SARA312,SARA313,WI_NR438 - WI_NR438 - AIR CONTAMINANT EMISSION INVENTORY REPORTING REQUIREMENTS
0064742-49-0	VM & P NAPHTHA	6% - 13%	DSL,SARA312
0000067-56-1	METHANOL	6% - 13%	Canada_NPRI,DSL,HAPS,SARA312,SARA313,WI_NR438 - WI_NR438 - AIR CONTAMINANT EMISSION INVENTORY REPORTING REQUIREMENTS
0000108-88-3	TOLUENE	6% - 13%	Canada_NPRI,DSL,HAPS,SARA312,SARA313,WI_NR438 - WI_NR438 - AIR CONTAMINANT EMISSION INVENTORY REPORTING REQUIREMENTS
NA-Repcolite	UREA-FORMALDEHYDE RESIN	5% - 13%	SARA312
NA-Repcolite	MELAMINE RESIN	2% - 6%	SARA312
0000100-41-4	ETHYLBENZENE	1.4% - 3%	Canada_NPRI,DSL,HAPS,SARA312,SARA313,CA_Carcinogen,WI_NR438 - WI_NR438 - AIR CONTAMINANT EMISSION INVENTORY REPORTING REQUIREMENTS
0068611-44-9	SILICON DIOXIDE (AMORPHOUS)	0.2% - 4%	DSL,SARA312
0000085-68-7	BUTYL BENZYL PHTHALATE	0.1% - 0.9%	Canada_NPRI,DSL,SARA312
0001317-65-3	CALCIUM CARBONATE	0.0% - 0.6%	SARA312
0000071-36-3	N-BUTYL ALCOHOL	0.0% - 0.3%	Canada_NPRI,DSL,SARA312,SARA313,WI_NR438 - WI_NR438 - AIR CONTAMINANT EMISSION INVENTORY REPORTING REQUIREMENTS
0008052-41-3	STODDARD SOLVENT	Trace	Canada_NPRI,DSL,SARA312,WI_NR438 - WI_NR438 - AIR CONTAMINANT EMISSION INVENTORY REPORTING REQUIREMENTS
0000050-00-0	FORMALDEHYDE	Trace	Canada_NPRI,DSL,HAPS,SARA312,SARA313,CA_TAC_Carcinogen,CA_Carcinogen,WI_NR438 - WI_NR438 - AIR CONTAMINANT EMISSION INVENTORY REPORTING REQUIREMENTS
0000108-65-6	PROPYLENE GLYCOL MONOMETHYL ETHER ACETATE	Trace	Canada_NPRI,DSL,SARA312

SECTION 16) OTHER INFORMATION

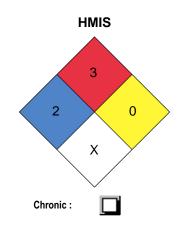

DISCLAIMER

To the best of our knowledge, the information contained herein is accurate. However, neither the above named supplier nor any of its subsidiaries assumes any liability whatsoever for the accuracy or completeness of the information contained herein. Final determination of suitability of any material is the sole responsibility of the user. All materials may present unknown hazards and should be used with caution. Although certain hazards are described herein, we cannot guarantee that these are the only hazards that exist. The above information pertains to this product as currently formulated, and is based on the information available at this time. Addition of reducers or other additives to this product may substantially alter the composition and hazards of the product. Since conditions of use are outside our control, we make no warranties, express or implied, and assume no liability in connection with any use of this information.